


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-270	Smoke	9/2/2009	ADS/TM	S11MM1027MH	Dry	Yes	1,493.72

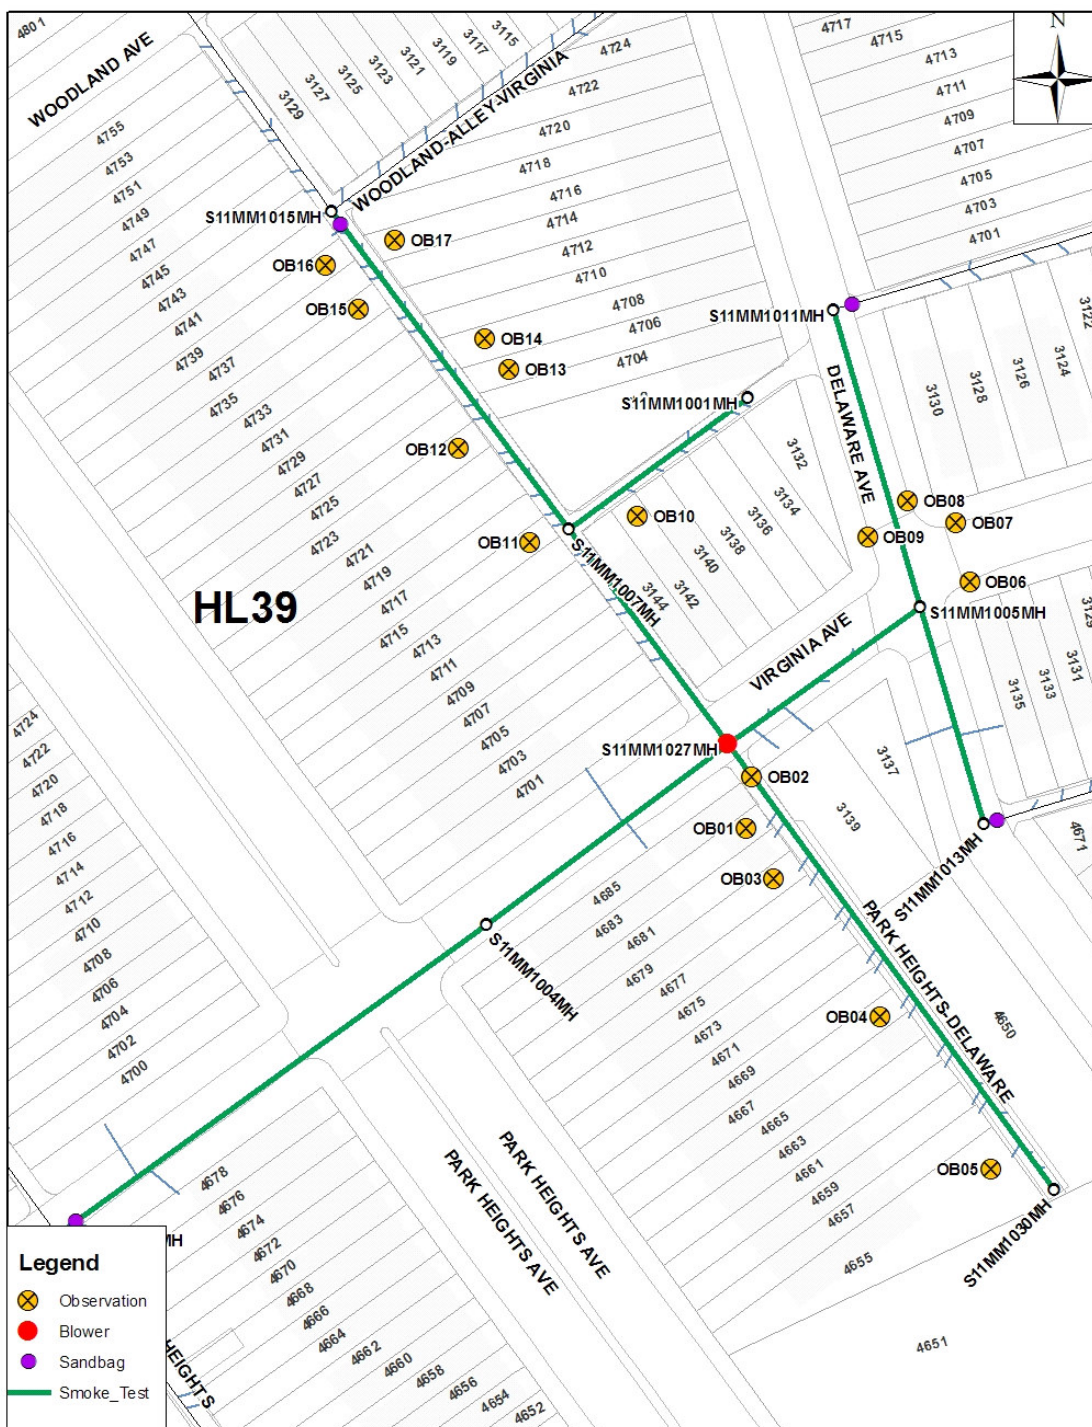

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-270	Smoke	9/2/2009	ADS/TM	S11MM1027MH	Dry	Yes	1,493.72

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S11MM1004G1	S11MM1004MH	S11MM1008MH	259.622	10
S11MM1027G1	S11MM1027MH	S11MM1004MH	148.323	10
S11MM1030G1	S11MM1030MH	S11MM1027MH	271.491	8
S11MM1005G1	S11MM1005MH	S11MM1027MH	115.94	8
S11MM1007G1	S11MM1007MH	S11MM1027MH	130.975	8
S11MM1011G1	S11MM1011MH	S11MM1005MH	152.093	8
S11MM1015G1	S11MM1015MH	S11MM1007MH	194.993	8
S11MM1001G1	S11MM1001MH	S11MM1007MH	109.015	8
S11MM1013G1	S11MM1013MH	S11MM1005MH	111.27	8

Observations & Photos

Obs_ID S1028-270-OB01

Address 4683 Park Heights Ave

Status Private

Source Service Lateral

Location Paved concrete

Nearest MH S11MM1027MH

Comments Smoke from service lateral in paved concrete behind house. 4683 Park Heights Ave.



Picture \S1028-270-OB01-P01.jpg

Comments Back of house, 4683 Park Heights Ave.

Obs_ID S1028-270-OB02

Address 3139 Virginia Ave

Status Public

Source Catch Basin

Location Alley

Nearest MH S11MM1027MH

Comments Smoke from catch basin in alley adjacent to 3139 Virginia Ave.



Picture \S1028-270-OB02-P01.jpg

Comments Alley adjacent to 3139 Virginia Ave. looking southwest

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-270	Smoke	9/2/2009	ADS/TM	S11MM1027MH	Dry	Yes	1,493.72

Obs_ID S1028-270-OB03

Address 4679 Park Heights Ave

Status Private

Source Service Lateral

Location Yard - back

Nearest MH S11MM1027MH

Comments Smoke from service lateral in back yard. 4679 Park Heights Ave.



Picture \S1028-270-OB03-P01.jpg

Comments Back yard, 4679 Park Heights Ave.

Obs_ID S1028-270-OB05

Address 4655 Park Heights Ave


Status Private

Source Service Lateral

Location Yard - back

Nearest MH S11MM1030MH

Comments Smoke from service lateral in back yard. 4655 Park Heights Ave.

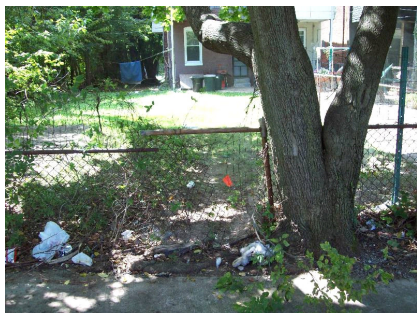

Picture \S1028-270-OB05-P01.jpg

Comments Back of house, 4655 Park Heights Ave.

Obs_ID S1028-270-OB04

Address 4667 Park Heights Ave

Status Private

Source Cleanout

Location Yard - back

Nearest MH S11MM1030MH

Comments Smoke from cleanout in back yard. 4667 Park Heights Ave.



Picture \S1028-270-OB04-P01.jpg

Comments Back of house, 4667 Park Heights Ave.

Obs_ID S1028-270-OB06

Address 3135 Virginia Ave


Status Public

Source Catch Basin

Location Curb

Nearest MH S11MM1005MH

Comments Smoke from catch basin along curb in front of 3135 Virginia Ave.

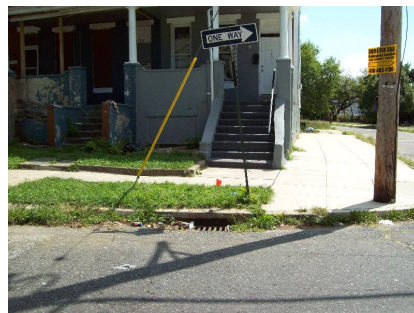

Picture \S1028-270-OB06-P01.jpg

Comments Front of house, 3135 Virginia Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-270	Smoke	9/2/2009	ADS/TM	S11MM1027MH	Dry	Yes	1,493.72

Obs_ID S1028-270-OB07

Address 3130 Virginia Ave


Status Public

Source Catch Basin

Location Curb

Nearest MH S11MM1005MH

Comments Smoke from catch basin along curb in front of 3130 Virginia Ave.

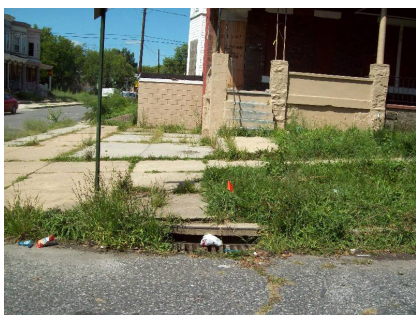

Picture \S1028-270-OB07-P01.jpg

Comments Front of house, 3130 Virginia Ave.

Obs_ID S1028-270-OB09

Address 3132 Virginia Ave

Status Public

Source Catch Basin

Location Curb

Nearest MH S11MM1005MH

Comments Smoke from catch basin along curb at side of lot. 3132 Virginia Ave.



Picture \S1028-270-OB09-P01.jpg

Comments Side of lot, 3132 Virginia Ave.

Obs_ID S1028-270-OB08

Address 3130 Virginia Ave

Status Public

Source Catch Basin

Location Curb

Nearest MH S11MM1005MH

Comments Smoke from catch basin along curb at side of 3130 Virginia Ave.



Picture \S1028-270-OB08-P01.jpg

Comments Side of house, 3130 Virginia Ave.

Obs_ID S1028-270-OB10

Address 3142 Virginia Ave

Status Private

Source Service Lateral

Location Yard - back

Nearest MH S11MM1007MH

Comments Smoke from service lateral in back yard. 3142 Virginia Ave.



Picture \S1028-270-OB10-P01.jpg

Comments Back of house, 3142 Virginia Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-270	Smoke	9/2/2009	ADS/TM	S11MM1027MH	Dry	Yes	1,493.72

Obs_ID S1028-270-OB11

Address 4715 Park Heights Ave


Status Private

Source Service Lateral

Location Yard - back

Nearest MH S11MM1007MH

Comments Smoke from service lateral in back yard. 4715 Park Heights Ave.

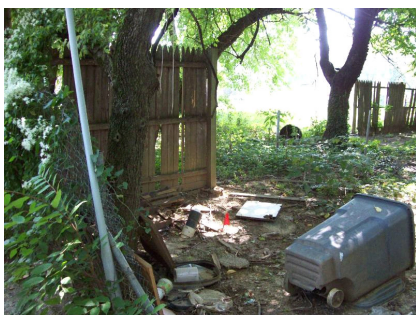

Picture \S1028-270-OB11-P01.jpg

Comments Back yard, 4715 Park Heights Ave.

Obs_ID S1028-270-OB13

Address 4706 Delaware Ave


Status Private

Source Cleanout

Location Yard - back

Nearest MH S11MM1007MH

Comments Smoke from cleanout in back yard. 4706 Delaware Ave.

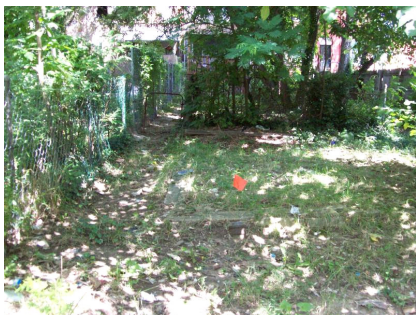

Picture \S1028-270-OB13-P01.jpg

Comments Back of house, 4706 Delaware Ave.

Obs_ID S1028-270-OB12

Address 4723 Park Heights Ave

Status Private

Source Service Lateral

Location Paved concrete

Nearest MH S11MM1007MH

Comments Smoke from service lateral in paved concrete behind house. 4723 Park Heights Ave.



Picture \S1028-270-OB12-P01.jpg

Comments Back of house, 4723 Park Heights Ave.

Obs_ID S1028-270-OB14

Address 4708 Delaware Ave


Status Private

Source Cleanout

Location Yard - back

Nearest MH S11MM1015MH

Comments Smoke from cleanout in back yard. 4708 Delaware Ave.

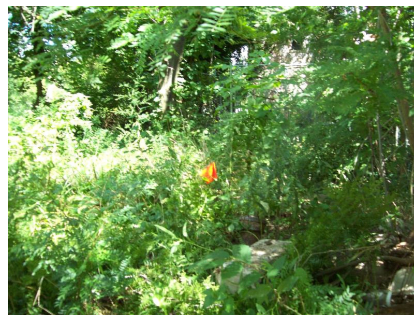

Picture \S1028-270-OB14-P01.jpg

Comments Back yard, 4708 Delaware Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-270	Smoke	9/2/2009	ADS/TM	S11MM1027MH	Dry	Yes	1,493.72

Obs_ID S1028-270-OB15

Address 4735 Park Heights Ave


Status Private

Source Cleanout

Location Yard - back

Nearest MH S11MM1015MH

Comments Smoke from cleanout in back yard. 4735 Park Heights Ave.

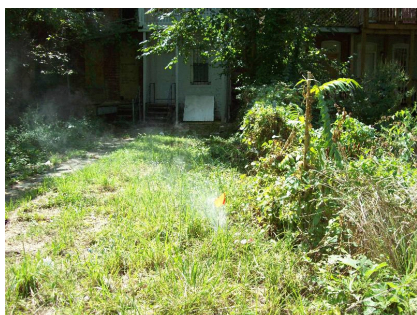

Picture \S1028-270-OB15-P01.jpg

Comments Back of house, 4735 Park Heights Ave.

Obs_ID S1028-270-OB16

Address 4739 Park Heights Ave


Status Private

Source Service Lateral

Location Yard - back

Nearest MH S11MM1015MH

Comments Smoke from service lateral in back yard. 4739 Park Heights Ave.

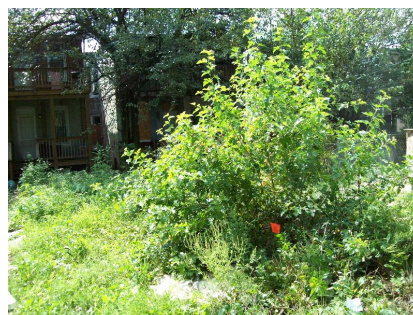

Picture \S1028-270-OB16-P01.jpg

Comments Back of house, 4739 Park Heights Ave.

Obs_ID S1028-270-OB17

Address 4716 Delaware Ave

Status Private

Source Cleanout

Location Yard - back

Nearest MH S11MM1015MH

Comments Smoke from cleanout in back yard. 4716 Delaware Ave.



Picture \S1028-270-OB17-P01.jpg

Comments Back yard, 4716 Delaware Ave.

